



THE KING OF SNOW®

Ariens Company
655 W. Ryan St.
Brillion, WI 54110
www.ariens.com

Service Bulletin

Product Family: Ariens Deluxe and Platinum Sno-Thro Models

Subject: Fuel Cap Issue

Dealer Action: Repair if Necessary

Model	Serial Number Range	Description
921029	100000 – 104968	ST30DLE PLATINUM 120
921032	100000 – 110361	ST30DLE DELUXE 120V
921038	000101 – 4792	ST24DLE PLATINUM SHO 120V
921040	000101 – 3413	ST30DLE PLATINUM SHO 120V

LCT® Corp. has issued an Informational Bulletin to address a fuel cap issue on Gen III engines used on the models and serial ranges listed above. Please reference the attached LCT Bulletin for additional information.

Standard warranty applies. Dealers will be reimbursed .10 hours at their standard shop labor rates for each machine repaired.

For additional information, dealers may visit the Dealer Extranet page on the Internet. Click on the "Dealer Support Portal" button, then click the "Ask a Question" tab to submit a comment or question to the Customer Support team. Dealers may also contact Ariens Technical Service at 920-756-4688.

Technical Service Bulletin



To: Ariens Technical Service Department

Subject: TSB #10001401A

Date: 12/15/2014

LCT Model(s) Affected:

08201019	PW8HK17950781DE-ABGILOQTUVX59E1M
08201020	PW8HK171000781DE-ABGILOQTUVX59E1M
08201021	PW8HK171250781DE-ABGILOQTUVX59E1M

Ariens Model(s) Affected:

921029	ST30DLE PLATINUM 120V
921032	ST30DLE DELUXE 120V
921038	ST24DLE PLATINUM SHO 120V
921040	ST30DLE PLATINUM SHO 120V

Dear Service Technician,

On certain snow blowers, reports of fuel leaking from the fuel cap vent have been attributed to overfilling the fuel tank or exceeding the normal operating angles.

Ariens Service Kit Number **52107500** provides a fuel fill level gauge to prevent overfilling.

LCT Service Kit Number: **20823951**.

Installation Instructions,

- (1) Remove fuel cap and discard.
- (2) Install the fuel strainer retention sleeve into the fuel tank neck.
- (3) Install fuel strainer into fuel strainer retention sleeve. The fuel strainer includes a red indicator to be used to determine the proper fuel level has been attained when filling, or re-filling the fuel tank.
- (4) Replace fuel cap with cap contained in service kit.